

The Investigation of Negative Effects of Salt Dome on the Quality of Water in the Gotvand Olya Dam and the use of Cut-off Wall as Treatment



Mahmood Mansournejad¹, Mansournejad@gmail.com
Behzad Kalantari², Professor Assistant, Behzad996@yahoo.com
Mehdi Mahdavi Adeli³, Professor Assistant, mehmahad@yahoo.com

Paper Reference Number: 07-66-8888
Name of the Presenter: Mahmood Mansournejad

Abstract

The fact that Gachsaran salt formation is located in the river on the back of Gotvand Olya dam, Karon River became more salt and the issue of destruction of agricultural fields located on the bottom of dam are hot issues in scientific associations and newspapers. Irrespective of any political perspective, the present research seeks to investigate this issue from scientific and practical point of view and evaluate the works done by employers and consultants with the aim of finding an effective treatment and examining the reasons for failure and unsuccessful attempts in this regards. In this paper, after introducing the dam project and conducting a comprehensive geological investigation in the determined territory and also introducing the treatment method used by the project's consultant which is based on construction of a clay wall along the salt dome, the sampling of the soil for construction of the mentioned wall and the upstream and downstream water was done. The results obtained from this test and sampling indicate the implausibility and impossibility of the wall and the necessity of investigating and prompt thinking about this issue.

Key words: Gachsaran Salt Dome, Gotvand Olya River, Clay wall, Water Quality

1. Introduction

Gotvand Olya Dam and power plant has been located on Karun River on 30 km north of Shoushtar, with the aim of generating 4500 kw/h electricity. The dam rock fill is gravel and pebbles with clay core, most of its materials are pebbles (23 million m³) and gravel clay (3.50 million m³). The river volume is 5.20 billion m³ and its length is 90 km. Therefore, studying the earth and mountains (geological formation) that are located on the river and their effects on the river water, including salinity variation pH, variation of river's pH, is of great significance.

2. Geographical location

Gotvand Olya Dam and power plant project site is located in 48°:56' E longitude and 32°:16':8" N latitude, in 380 km of the mouth of Karun River, 10 km on northeast Gotvand and 30 km of Shoushtar in Khuzestan province.

1- Hormozgan University, Pardis-e-Qeshm, Civil Engineering Group, Qeshm, Iran

2- Hormozgan University, Civil Engineering Group, Bandar Abbas, Iran

3- Islamic Azad University, Shoushtar branch, Civil Engineering Group, Shoushtar, Iran

3. The site of dam construction

The construction site of Gotvand Olya dam in terms of geology division is in the construction zone of folded Zagros and includes two formations of Bakhtiyari and Aghajari. Right and left abutment of the dam are located in Bakhtiyari conglomerate and the central foundation is located on Aghajari formation is located. In the right abutment of dam, there are a mass and a fault of Bakhtiyari formation and the Bakhtiyari formation is there and Aghajari is located below them. Aghajari formation of the central part of foundation includes two anticlines and one asymmetric syncline. Of the main features of this formation in terms of sealing, is the presence of gypsum in this formation, which is in form of fine crystals dispersed in the rocks, filling in the seams and in form of streak with low thickness between marly rocks. The left abutment also consist of a mass and a long, steeped wall of Bakhtiyari formation, under which Aghajari formation has been located. In both abutments, there is a transition area between Bakhtiyari and Aghajari formations which has been called “middle area”. Generally, it is likely that the water escape from right and left abutments due to presence of some mass and faults in Bakhtiyari formation, also dissolution of gypsum streaks in Aghajari formation is likely during the time which makes the water escape.

4. The site of the river (Dam’s Reservoir)

The dam reservoir, being longer than 90 km, is surrounded by Aghajari, Mishan, Lahbari, Bakhtiyari (conglomerate, Figure 1)



Fig 1: Location of dam’s reservoir foundations.

Table 1. Specification of reservoir formations.

	Formation name	Specification of the formation soil	Thickness (m)
1	Gachsaran	Deposits like Bytom bearing shale, anhydrite, salt, thin layer of limestone and red to gray marls are litho logy.	2000
2	Aghajari	Brown to gray sandstones, red marls, gypsum and silt stone.	2965
3	Bakhtiyari	1/3 of this periodic formation is hard and resistant conglomerate and	518

		conglomerate sandstone and siliceous rock. The rest of this formation includes massif conglomerate and thin layers of grindstone.	
4	Mishan	Gray marl and shelly limestone, 60 meters of the periodic section is consisted of shelly limestone, marls creamy layers and riff limestone.	710
5	Libheri	Colorful salt stone with gypsum, sale marl and sandstone with gypsum layers	1575

Gachsaran formation outcrops, which are located on 5 to 9 km upstream of the dam and in left side of the river, have outcrops made from thick layers of salt. The mentioned evaporated deposits are very soluble, especially at the present of water flow. Due to direct contact of the reservoir and salt deposits, serious problems might happen as a result of water pollution (salinity of the reservoir) [3].

5. Gachsaran Formation

Deposits like Bytom bearing shale, anhydrite, salt, thin layer of limestone and red to gray marls constitute its main lithology, and maximum thickness of this formation reaches almost 2000 m. Gachsaran formation has been made of seven sections (table 2).

Table 2. Different sections of Gachsaran formation.

	Specification of the formation soil	Thickness
1	It is stone which is like steep on Asmari structure and includes thick layer of limestone with Bytom bearing shale or thick layers of anhydrite	40
2	A thick layer of salt and anhydrite and limestone layers	114
3	Includes salt, anhydrite and thin limestone and marl layers from down-up	226
4	Thick salt layers with gray marl, limestone and lithology anhydrite	800
5	Anhydrite and marl with alternative layers of limestone and grayish red marl	318
6	Anhydrite, red marl and limestone, the middle layers is salt and anhydrite	278
7	Anhydrite and gray marl with marl limestone which is of the same steep with Mishan formation	317

6. Salt Dome

Due to tectonic pressure, salt is compressed and turned into a vertical mass with high thickness. Due to physical properties and fluidity, Gypsum and salt formation creates certain structural form called salt tectonic at the time of orogeny. At the time of orogeny, the pressure and heat is high in depth of the earth and the evaporated water leads to severe hydration of salt. In this condition, stones and rocks are not as stable as in earth surface, instead they are plastic paste and evaporated rocks and other plastic rocks like clay and marl will be the same in salt orogeny process [1].

7. The actions taken for treatment of Gotvand dam

Since Gachsaran formation has been located in Gotvand Olya dam reservoir and for tackling the problems at the time of impounding, treatment operation of Gachsaran formation including embankment according to technical specifications provided by the project consultant, has been transferred to the specialized contractor of this project. Concerning the time plan for the first process of impounding the dam in August 2011, the contractor designated the second contractor for facilitation of operation in zones 3 and 4 for five months since May 2011. The treatment was executed in 6 km from upstream axis of Gotvand Olya and in the dam reservoir for 3 km [6].

8. Operation method of contractor

The initial investigation done by the designing consultant of Gotvand Olya dam indicates the presence of some mass in the Gachsaran formation in the lake of Gotvand Olya dam, the most important and biggest, called Anbal salt dome is located near the dam axis.

Initial investigation conducted by the Design Consultant Upper Dam Scroll indicated the presence of a mass in the Salt Lake Dam Gotvand Olya Gachsaran is the most important and most orogeny salt mountain near the dam axis is located. Concerning the consequent problems, whether environmental like salinity of dam lack and river or technical and engineering problems related to the main and subordinate structures of Gotvand Olya dam, which might happen especially for power plant, some proposals and plans, was offered by design team. Finally, the treatment method including covering the outer level of salt mass by the use of clay and Riprap construction material was approved [6].

The scope of operation include four zones, zone one and two have been assigned to the first contractor and zones three and four, covering 1150 m, were assigned to second contractor on 22 April 2011 (figure 2). First, after cleaning the excavated trenches and debris, first seven meter from the edge of the trenches of clay material with proper thickness and density of more than 92% were executed (density testing method for clay is TM1556 and for pebbles is TM5030). Then, close to clay material, trenches materials were implemented without any contraction and for 2 meters. At the end, rip rap materials have been used to cover the material with more than 1.5 meter width. Treatment operation has been done by two procedures; the first one has been done before and after impounding [6].

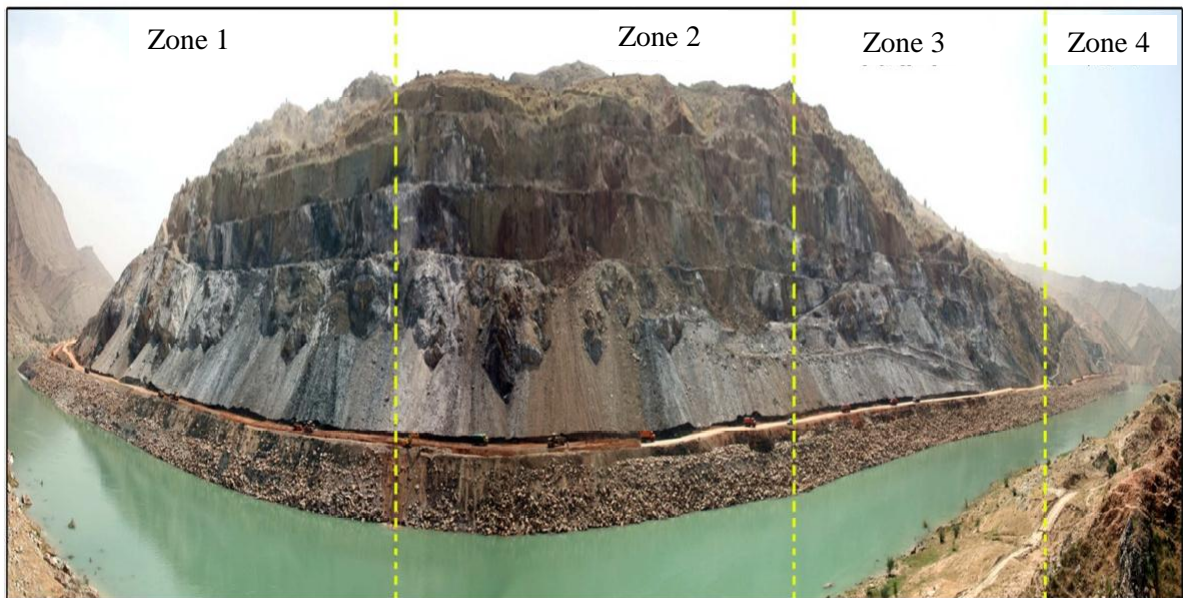


Fig 2: The zoning area of Gachsaran formation

9. Changes in the plan

After the first step in Gotvand Olya dam impounding, due to rapid impounding of the reservoir, some tracks and holes were created in embankment area, so based on the design consultant some changes were applied in the implementation method of the band, the most important of which are as follow:

- Cancelling the transition later implementation: due to sinking of the only mine of these materials SB
- Change in the implementation method of materials: after impounding, for stability and filling of the hole, clay and riprap materials were evacuated in form of damp on the band and the contraction of material was done by the traffic of road construction machineries (figure3).

- After impounding, due to safety concerns, the consultant of this project began amending the tranches of zone 3 [5].

Technical features of clay in clay wall: The clay used in clay wall is prepared from mines C6 and C11 which are located near the project site. According to the results obtained from soil aggregation and grading and concerning Eterberg value done on the soil sample of the mentioned mines in the accredited laboratories, it was found that the used clay CL has the following specification:

Pasty interval: PI=14%

Liquidity limit: LL=35%

Pasty limit: PL=21%

Shrinkage Limit: SL= 18%

Concerning the results obtained, reviewing the prepared photos and according to the opinion of experts engaged in the project, the quality of soil was evaluated as somehow mid to low.



Fig 3: cracking in the embankment after dam impounding

10. Implementation method of clay wall

Based on the technical specification and the instruction provided by project consultant and contractor, first the clay should be used in clay wall in form of 30 cm layers. After preparation procedures including spraying, mixing, regulating and pummelling by the proper rollers, the final thickness of each layer should reach 25 cm, then after executing density test and determining soil density (at least 92%), the next layer will be implemented. However, due to contractor's hurry for dam impounding in the shortest possible time, the embanking process was executed unsystematically. The first step before impounding is embankment, which has been done in 70-90 cm layers, and then preparation and pummelling have been done. The second step is after impounding, which due to not preserving technical principles in the first step, immediately after impounding, the built wall subsided. For removing this problem, according

to the report provided by the contractor, the embankment operation was done by soil deposit and the contraction was done by traffic of road-construction machineries.

11. Clay wall embankment analysis

1. Concerning the test results, the clay used in construction of clay wall is salty clay with shrinkage limit of 18%. For reaching the maximum density and weight, it is require contracting the soil with 18% moisture while for determining the moisture percentage, the design consultant used TM1556 modified proctor test. Concerning the laboratorial information and experiences obtained for clay soil in modified proctor density test, the moisture is almost 16% which is less than shrinkage limit, this indicates that in this soil test method, not enough moisture is provided for contraction.

2. Concerning the applied energy by the rollers, also distribution of load in the soil, if the thickness of embankment layers increases, enough energy is not supplied and provided for contraction of the below layers so just the upper layers of the soil will be contracted. Due to this, according to executive bylaws and instruction the thickness of embankment layers should not exceed 30 cm before pummelling while in the first step in executing and building clay wall, the thickness of layers is three times more (80-90 cm) which leads to proper contraction of the soil.

3. In embankment process, after impounding of the dam, embankment is done by traffic contraction. Concerning the fact that the applied force by the road-construction machineries is low and the width of their tier is at most 50 cm, also due to high height of embank and its low width, the possibility of this machineries for manoeuvring will reduce and there is just the possibility of partial and incomplete contraction under the wheels.

12. Conclusion

Concerning the collapse of clay wall at the first stage of impounding, and the results obtained from testing the water on the upstream and downstream of the salt mountain and it becomes obvious that the quality of water in downstream has reduced meaningfully, however it is still in its standard range. The results indicate that the treatment plan done by contractor has not been effective for Salt Mountain, which is due to not systematic and technical implementation due to hurrying and finishing the project and not accurate and scientific investigation before implementation of the mentioned project. Concerning the slow process of salt solution in the water, it is required to do chemical investigation on water in different time interval in the year, so in case of increase of chemical materials released by Salt Mountain in the water, the scientific actions to be taken.

References

1. Tehrani, Khosro. *Zminshenasie Omumie Iran* (General Geology of Iran)
2. Iran Water and Power Resources Development Company, General specification of Gotvand Olya project and power plant (2008)
3. Zarei, H and Damoun, N. (2009). "Development of Tick Salt Layers of Gachsaran Formation in Gotvand Olya dam Reservoir in its Effect on Water Quality".
4. Karampour. (2009). "Formations Including Gotvand Olya Dam Lake"
5. Rahimi, H. *Soil Dams (Sad haye khaki)*
6. Sepasad Engineering Company. (2011). Report: Introduction and Explanation of the Actions Taken for Treatment of Gachsaran Formation Plan.